

SHIP8, INC.

ATTN: ACCOUNTS PAYABLE
 45875 NORTHPORT LOOP EAST
 FREMONT, CA 94538
 US

AP.SHIP8@SHIP8.COM

ORDER FROM

101144

PEARCE HEATING & AIR CONDITIONING, INC.
 PO BOX 1199
 WINTERS, CA 95694
 US

SHIP TO

WDC(4000),
 SHIP8, INC.
 ATTN: CHRISTINE JENKINS
 221 HANSON WAY
 WOODLAND, CA 95776
 US

Buyer

Purchasing Dept

Terms

30 days

FOB

FOB Origin

Ship Via


Best possible

Line No.	Vendor Item No.	Vendor Item Description	Qty Ordered	UOM	Unit Price	Extended Price
1	BLD003-HVAC	Diagnostic Fee AC not working Guard Shack	1.00	Each	125.00	
2	BLD003-HVAC	REPLACE DUALCAPACITOR	1.00	Each	429.61	
3	BLD003-HVAC	REPLACE BLOWER MOTOR RUN CAPACITOR	1.00	Each	194.05	
4	BLD003-HVAC	BASIC WIRING REPAIR	1.00	Each	248.25	

Total Extended Price =



Replace Blower Motor Run Capacitor

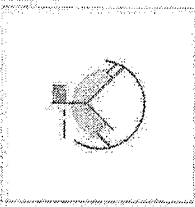

Basic Wiring Repair

Standard Price \$275.00

Member Savings -\$27.56

Total Price \$247.25

Basic Wiring Repair

Subtotal \$1,093.79

Tax \$0.00

Member Savings -\$96.88

Total \$996.91

ESTIMATED BY [Signature]

Contract Us



Hello, this is your estimate

Location: 2222 East Beamer Street, Woodland, CA, 95776

APPLY FOR FINANCING
JOB ID
61205135

Repair


As Low As \$96.25/hrs

Your Price
\$996.91

Member Savings
-\$96.88




Summary

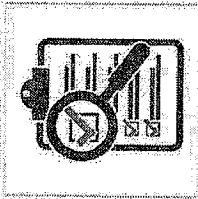

Commercial Diagnostic

Your Price
\$125.00

Provided a professional consultation to determine the customer's needs/concerns and/or solutions.

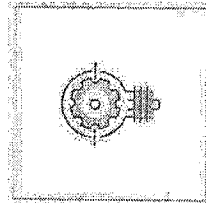

Dual Capacitor

Standard Price
\$477.95

Your Price
\$429.61

Member Savings
-\$47.74

Replace Dual Capacitor



Run Capacitor

Standard Price
\$235.02

Your Price
\$194.05

Member Savings
-\$21.56

Job #61205135

Diagnostic Report - HVAC

Customer Name

Ship 8 Inc.

Technician


Matt B.

Date

2025-03-26

Reason For Call

No cooling

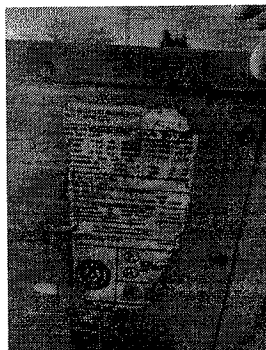Data Plate

Make

Manufacturer of the unit.

American Standard

Model/Product Number

Model/Product number of the unit.

TCC018F100BC

Serial Number

Serial Number of the unit.

M161LDR2H

Manufactured/Installed Date

Manufactured/Installed date of the unit.

1997

Type of Unit

Type of Unit


Package Unit

Type of Unit: Other


Type of unit if you chose other.

-


Picture of T-STAT(s)

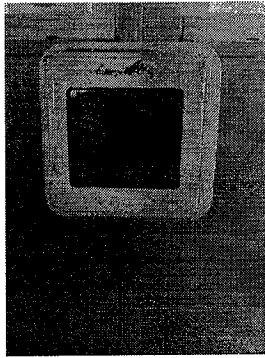


Picture of Blower Motor

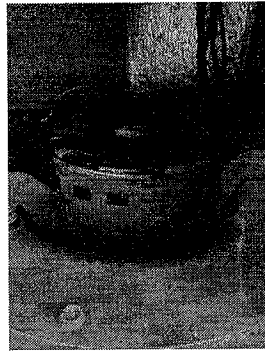

Picture of Indoor Coil

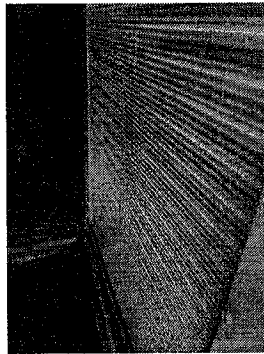

Picture of Filter

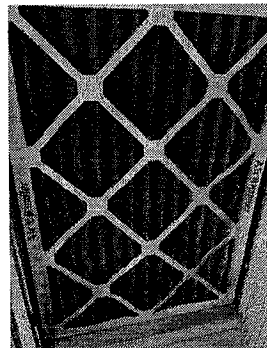

Description of Findings

Package AC unit with electric strip heater almost 28 years old. At arrival of guard shack found the system not running in cooling due to a burned up common wire at the compressor terminal box & both run capacitors either weak or dead. Installed new spade connector for the common wire of the compressor & installed new dual run capacitor for the compressor/outdoor fan & installed a new run capacitor for the blower motor. System now running properly in cooling blowing cold air. Please replace the air filter asap filter dirty 14x20x1

Repair Status:

Repair completed.

Customers Expectations

What are the customers expectations of next steps if any are needed

Please replace the 14x20x1 air filter.


Put Out Door Hanger(s)?

Not Applicable

Door Hanger(s) - Picture(s)

Picture of the Door Hanger(s) on the Door(s).

N.A.

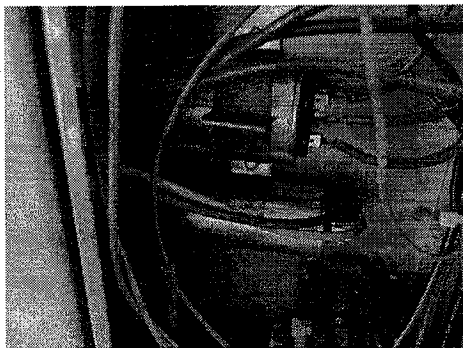Additional Pictures



Pearce Heating & Air Conditioning, Inc.
 PO BOX 1199, Winters, CA 95694 United States
 (530) 795-4300

BILL TO

Ship 8 Inc.
 2222 East Beamer Street
 Woodland, CA 95776 USA

INVOICE 61205135	INVOICE DATE Mar 26, 2025
----------------------------	-------------------------------------

JOB ADDRESS

Ship 8 Inc.
 2222 East Beamer Street
 Woodland, CA 95776 USA

Completed Date:
Payment Term: Net 30

TASK	DESCRIPTION	QTY	PRICE	TOTAL
Notes	PO 25030327	1.00	\$0.00	\$0.00
Commercial Diagnostic	Provided a professional consultation to determine the customer's needs/concerns and/or solutions.	1.00	\$125.00	\$125.00
Dual Capacitor	Replace Dual Capacitor	1.00	\$429.61	\$429.61
Run Capacitor	Replace Blower Motor Run Capacitor	1.00	\$194.05	\$194.05
Basic Wiring Repair	Basic Wiring Repair	1.00	\$248.25	\$248.25

MEMBER SAVINGS	\$96.88
SUB-TOTAL	\$996.91
TAX	\$0.00
TOTAL DUE	\$996.91
BALANCE DUE	\$996.91

Thank you for choosing Pearce Heating & Air Conditioning, Inc.

This invoice is agreed and acknowledged. Payment is due upon receipt. A service fee will be charged for any returned checks, and a financing charge of 1% per month shall be applied for overdue amounts.